

Technical Service Bulletin



Trim for Tailgate Noisy

70 06 03 Oct. 20, 2006, 2012960/1

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6	2005 – 2006	All	Not Applicable

Condition

The tailgate rattles when driving on poor roads.

Technical Background

- 1.The foam strip under the trim has come off.
- 2.There is not enough space between the trim and the body.

Production Solution

Switched to using a new foam with textile adhesive tape.

Service

- 1.Remove the tailgate trim and check to see if the foam strip has come off. (See Illustrations 1 and 2.) Remove the old foam, including the adhesive tape, and use new adhesive tape (Part No. 8E0 831 575 A) to reattach the foam.
- 2.Attach felt to all contact surfaces, such as support turrets and edge areas of the trim. (See Illustrations 3 and 4.)
- 3.The plastic turrets must be glued with body bonder to ensure a firm fit, as shown by the yellow circles in Illustration 4.

Illustration 1



Illustration 2


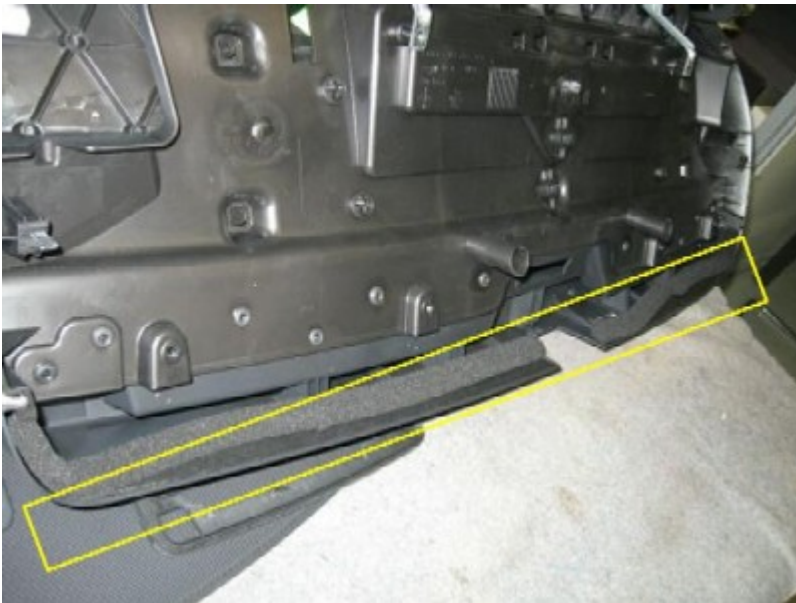


Illustration 3



Illustration 4

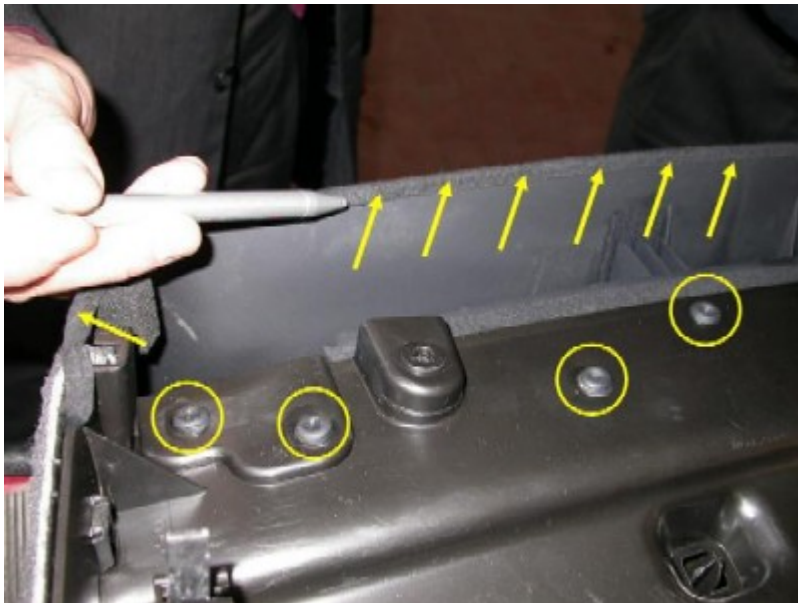

Technical Service Bulletin



Warranty

When procedure applies to vehicles within the New Vehicle Limited Warranty, use the following:			
Claim Type:	W2		
Part Identifier:	7087 (sedan) 7092 (avant)		
Damage Code:	7087 20 002 1 (sedan) 7092 20 002 1 (avant)		
Labor Operations:	7087 19 00 (sedan)	Remove and install tailgate trim	40 TU
	7092 49 99 (sedan)	Modify tailgate trim	50 TU
	7092 19 00 (avant)	Remove and install tailgate trim	40 TU
	7092 49 99 (avant)	Modify tailgate trim	50 TU
Diagnostic Time:	No Diagnostic Time Allowed		
Claim Comment:	As per TSB #2012960/1		
All warranty claims submitted for payment must be in accordance with the Audi Warranty Policies and Procedures Manual. Claims are subject to review or audit by Audi Warranty.			

All part and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.

