

Technical Service Bulletin



Hose to rear washer jet leaking; Bose soundsystem, MMI, or navigation without function

92 06 01 Oct. 24, 2006, 2013209/1

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6 Avant	2005	All	Not Applicable
A6 Avant	2006	4F_6N000001 – 4F_6N060000	

Condition

- 1.Rear washer jet is without function.
- 2.Bose sound-system, MMI, telephone, or navigation without function.

Technical Background

The washer fluid hose to the rear washer jet breaks near the last mounting on the D-pillar due to opening and closing of the tail gate. (See Illustration 1.)



As a result, the washer fluid is entering the vehicle in the left rear corner causing water ingress to the electrical connections of one or more electrical components.

Technical Service Bulletin

Production Solution

Additional installation of a rubber hose to offer additional support in the area of movement of the original water line. (See Illustration 2.)



Service

1. Remove both D-pillar trim, tail gate trim and rear headliner trim.
2. Replace a section of the original water hose by cutting approximately 5 cm beyond the last mounting point of the hose. (See Illustration 3.)



Technical Service Bulletin



3. Remove the cloth insulation tape from both ends of the water hose and install connector piece 1J0 955 875. (See Illustration 4.)



4. Cut the replacement hose, part number N 018 046 3, to the same length as the removed section of water line minus 2 cm and install connector piece 1J0 955 875 R. (See Illustration 5.)



5. Cut two pieces of the heat shrink tubing (approximately 8 cm each) and slide over the hoses prior to connecting hoses together. (See Illustration 6.)



6. Move the heat shrink pieces over the connecting pieces and heat using hot air gun. *Heat the heat shrink from the center to the outside.*

7. Install additional cloth tape above the heat shrink tubing. (See Illustration 7.) Install the repaired hose back to the original mounting points using new tie straps.



8. Test the rear washer system for proper operation and ensure that no leak is present.

9. Reinstall removed trim panels.

Technical Service Bulletin




Warranty

When procedure applies to vehicles within the New Vehicle Limited Warranty, use the following:			
Claim Type:	W2		
Part Identifier:	9254		
Damage Code:	9254 003 2		
Labor Operations:	70 69 19 04	D- pillar trim remove and reinstall	40 TU
	70 92 19 00	Tailgate trim remove and reinstall	40 TU
	92 54 41 99	Repair washer hose to rear washer jet	20 TU
Diagnostic Time:	Diagnostic time reimbursement follows guidelines printed in Section 2.2 of the <i>Audi Warranty Policies and Procedures Manual</i>		
Claim Comment:	As per TSB # 2013209/1		
All warranty claims submitted for payment must be in accordance with the Audi Warranty Policies and Procedures Manual. Claims are subject to review or audit by Audi Warranty.			

For additional repairs due to water damage by a leaking washer fluid hose please use the appropriate labor operations in ELSA

Required Parts and Tools

Part Number	Part Description	Quantity
1J0 955 875	Connector piece	2
1J0 955 875 R	Connector piece	2
000 979 992	Sleeve (heat shrink)	2
N 018 046 6	Hose (5 m to a roll)	as needed
N 909 377 02	Tie strap 4.6 x 193	2
000 979 950	Cloth tape	as needed

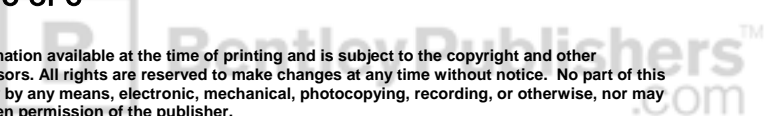



Additional Information

All part and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.