



Technical Service Bulletin

Coming/leaving home function intermittently doesn't work when unlocking doors with the remote control

97 06 03 Dec. 7, 2006, 2013709/1

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6	2005 – 2006	All	

Condition

Coming Home / Leaving Home function intermittently does not work when unlocking the doors with the remote control.

After operating the remote control twice in a row, it works again.

Technical Background

Timing problem of the driver side power supply control module (**J519**).

Production Solution

New software in the driver side power supply control module (**J519**) resolved the problem.

Service

- Update the driver side power supply control module (**J519**) using the SVM action code as listed in the table below.

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Action Code
A6	4F0 910 279A	All	4F0 910 279J	00240	NA4F97MY01
	4F0 910 279C				
	4F0 910 279F				
	4F0 910 279	All	4F0 910 279K		
	4F0 910 279D				
	4F0 910 279G				
	4F0 910 279E	All	4F0 910 279L		

Technical Service Bulletin



Tip: The SVM Process must be completed in its entirety so the database receives the update confirmation response. A warranty claim may not be reimbursed if there is no confirmation response to support the claim.

- For further SVM update instructions and troubleshooting, please refer to the *SVM Operating Manual; ElsaWeb TSB 2011732*.

Warranty

When procedure applies to vehicles within the New Vehicle Limited Warranty, use the following:			
Claim Type:	W2		
Part Identifier:	9710		
Damage Code:	9710 39 002 1		
Labor Operation:	97 10 25 99	Program driver side power supply control module	85 TU
Diagnostic Time:	Diagnostic time reimbursement follows guidelines printed in Section 2.2 of the <i>Audi Warranty Policies and Procedures Manual</i>		
Claim Comment:	As per TSB #2013709/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- 2011732; Software Version Management (SVM) Operating Manual

All part and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.