



HYUNDAI Technical Service Bulletin

Group	BODY
Number	09-BD-008
Date	JULY, 2009
Model	GENESIS COUPE (BK)

Subject	QUARTER INNER PANEL NOISE REPAIR
---------	---

CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY MGR	<input type="checkbox"/> SALES MANAGER

DESCRIPTION:


Some Genesis Coupe vehicles may exhibit a vibration noise originating from the rear quarter inner panel.

APPLICABLE VEHICLES:

Model: Genesis Coupe (BK)



Applicable Vehicle Production Date Range: Dec 16, 2008 to Jan 30, 2009

PARTS INFORMATION:

PART NAME	PART NUMBER	DESCRIPTION
Pad-Quarter Inner Cover 	84191-2M000-FFF	- Size : 120mm x 15mm - Thickness : 3mm - Quantity : 6EA
	84192-2M000-FFF	- Size : 80mm x 15mm - Thickness : 3mm - Quantity : 2EA

SERVICE PROCEDURE:


1. Partially remove the left door weatherstrip (A) and the scuff trim (B) bordering the left quarter inner panel.

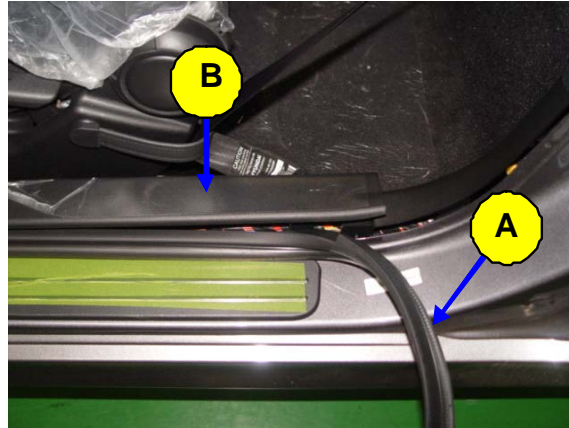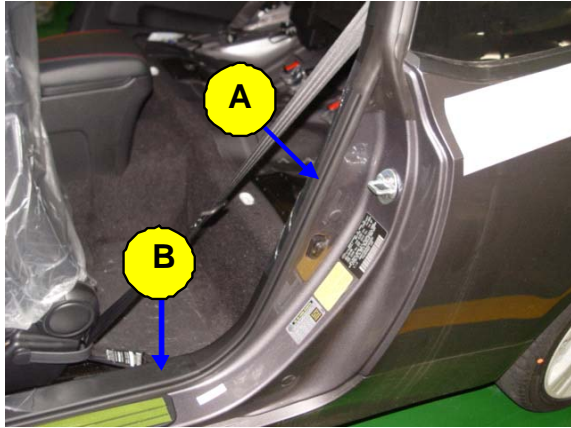


2. Open the blanking cover (C) and remove the bolt. Remove the rear pillar trim (D).

**NOTE: Tightening torque : 4.9 ~ 5.8 Nm
(0.5~0.6 kgf.m, 3.6~4.3 lbf.ft)**

CAUTION: Be careful not to damage the rear pillar trim.

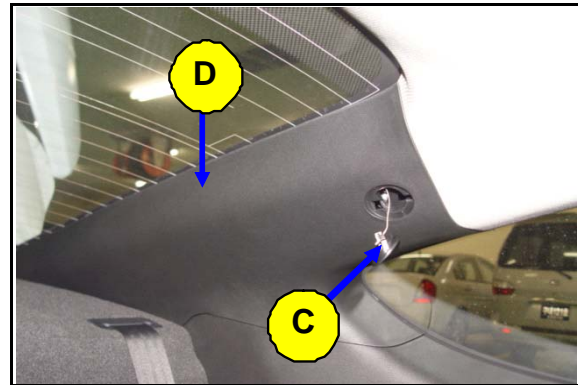

3. Pull both the right and left rear seat belts to release them from the seat belt guides (E).

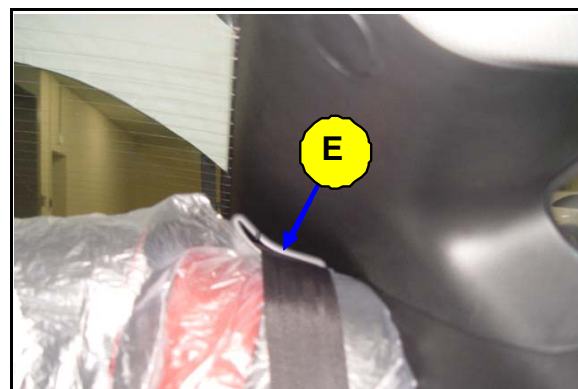



HYUNDAI Technical Service Bulletin


Group

BODY

Number

09-BD-008

4. Release the latch on the upper seat back by pulling the latch release lever (F).

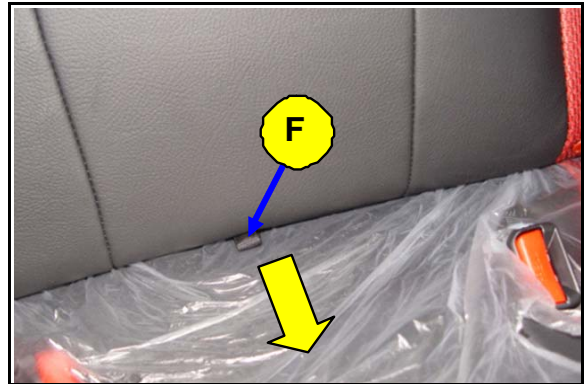


5. Fold the rear seat back (G).



6. Remove the left quarter inner lower trim (H).

CAUTION: Be careful not to damage the trim.

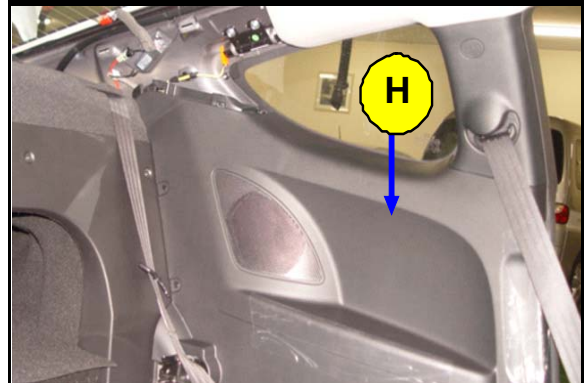

NOTE: The quarter inner lower trim is equipped with 6 retaining clips & 2 plastic screw clips.




7. Remove the left quarter inner panel cover by unfastening the 9 bolts.

NOTE: To access the lower bolts, lift the seat cushion up


NOTE: Tightening torque: 0.5 ~ 0.6 kgf.m

CAUTION: When reinstalling the quarter inner panel cover, first fasten the 2 bolts shown .

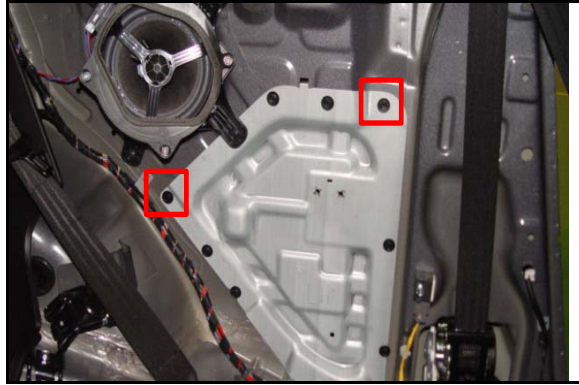

8. Apply the 120mm anti-squeak pads (I) supplied in the kit and the 80mm anti-squeak pad (J) as shown.

9. Install all the removed components in reverse order of removal.

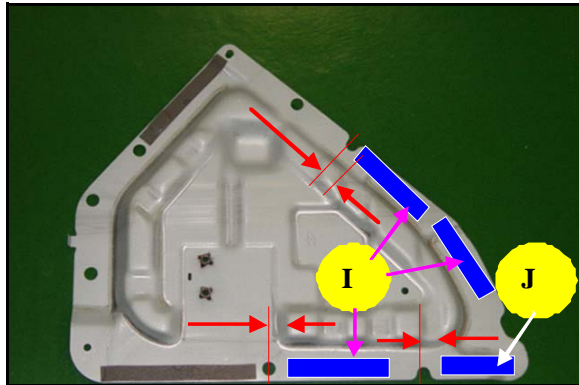

WARRANTY INFORMATION:

OP CODE	OPERATION	OP TIME	CAUSAL PART #	NATURE CODE	CAUSE CODE
89191F00	QUARTER INNER PANEL NOISE REPAIR	0.3 M/H	855202M0009P (RH) 855102M0009P (LH)	N29	C09